


DENSYL MASTIC

INSTRUCTIONS FOR USE


Use: For the sealing of ducts and service entry sleeves against entry of water or gas. For moulding around irregular profiles such as flanges, valves and couplings to provide a suitable contour for wrapping with anti-corrosion tapes.

Surface Preparation: Surfaces must be clean, dry and dust free. Remove all loose rust, scale and flaking coatings by scraping, wire brushing or blast cleaning.

Priming: For duct or sleeve sealing do not use primer. For profiling prior to the application of anti-corrosion tapes, apply appropriate primer for the tape (e.g. DENSO PASTE for DENSO TAPE or DENSO PRIMER D for DENSOPOL or DENSOCLAD cold applied laminate tapes).

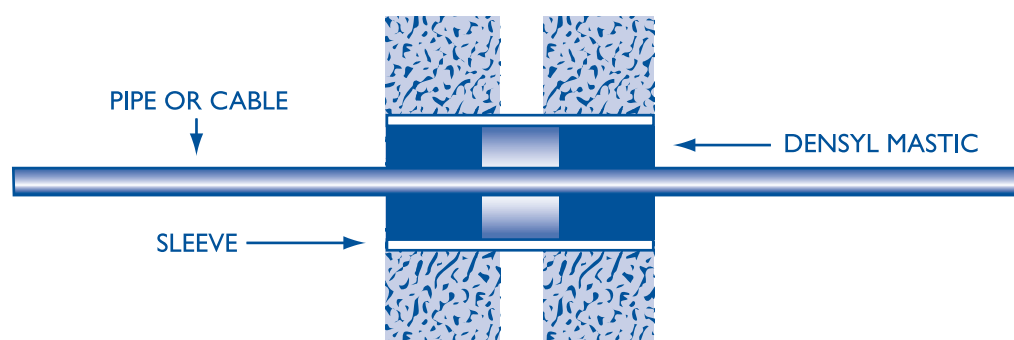

Application:
(a) Ducts, Sleeves and Service Entries Pack DENSYL MASTIC by hand into the annular space between the cable or service pipe and the duct or sleeve pipe. Force the mastic into the gap to a depth at least equal to the diameter of the sleeve or duct. Smooth the exposed surfaces and ensure that the spaces between pipes or cables are properly sealed.

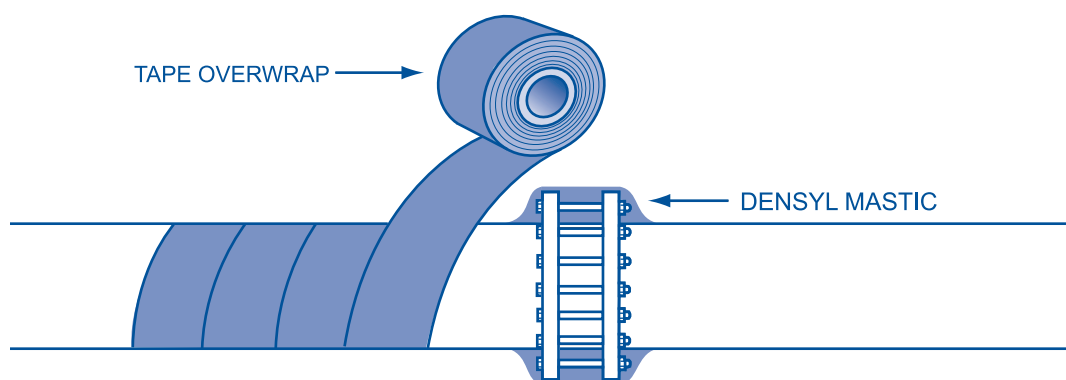

(b) Valves, Flanges and Couplings Prepare the surface and apply primer required for the anti-corrosion tape. Press DENSYL MASTIC into cavities, into angles to form a fillet and around bolt heads to form a rounded profile suitable for wrapping with tape without forming bridges or voids.

Overwrapping: DENSYL MASTIC BLANKETS must be wrapped with anti-corrosion tape to complete protection. See 'Instructions for Use' for the particular tape. Detailed instructions and quantities tables for standard fittings are available from the manufacturer.

DENSYL MASTIC

INSTRUCTIONS FOR USE

Safety Data

Storage: Store correct way up in original packaging. Store away from direct heat and open flames. **Note:** In cold weather, store the mastic for several hours in a warm room immediately prior to use.

Transport: No special precautions necessary.

Handling: Grease resistant gloves are advised to reduce skin contact.
Avoid contact with face, arms, etc.
Wash thoroughly after use and before work breaks to remove compound from the skin.
Careful attention should be given to personal hygiene.
Change and clean soiled clothing.

Action in case of

Fire: Extinguish with dry powder, carbon dioxide or chemical foam.
Air breathing equipment may be necessary in case of a large fire.

Skin contact: Wash with warm water and mild soap.

Eye contact: Irrigate eyes thoroughly with clean water.

Inhalation: Not applicable.

Swallowing: Obtain medical advice if necessary.

Spillage: Not applicable.

Disposal: Incineration or approved dumping.



Certificate No. FM 01548
BS EN ISO 9001:2008



Winn & Coales (Denso) Ltd, Denso House, Chapel Road, London SE27 0TR
Tel: 020 8670 7511 ● Fax: 020 8761 2456 ● Email: mail@denso.net ● Web: www.denso.net

A Member of Winn & Coales International